




Rover Group Mini 1.3injection

CLTB 0016

THE IMPORTANCE OF FITTING THE CORRECT CLUTCH KIT HK6604 TO MINI 1.3injection models.

Concerns; We have had several instances now where the incorrect clutch cover/clutch kit assembly has been fitted to the 1.3i Mini. The incorrect kit part numbers being HK8150 and HK9064. Although the clutch covers look very similar to the one in HK6604 there are subtle differences with the drillings and tapped holes in the central hub mounting face, which then controls the position of the timing ring when the flywheel is fitted. If the wrong one is fitted, the car will be difficult to start and does not run correctly.

Method; The differences on the drilling patterns are indicated below. Please ensure the correct type of cover/clutch kit is fitted.

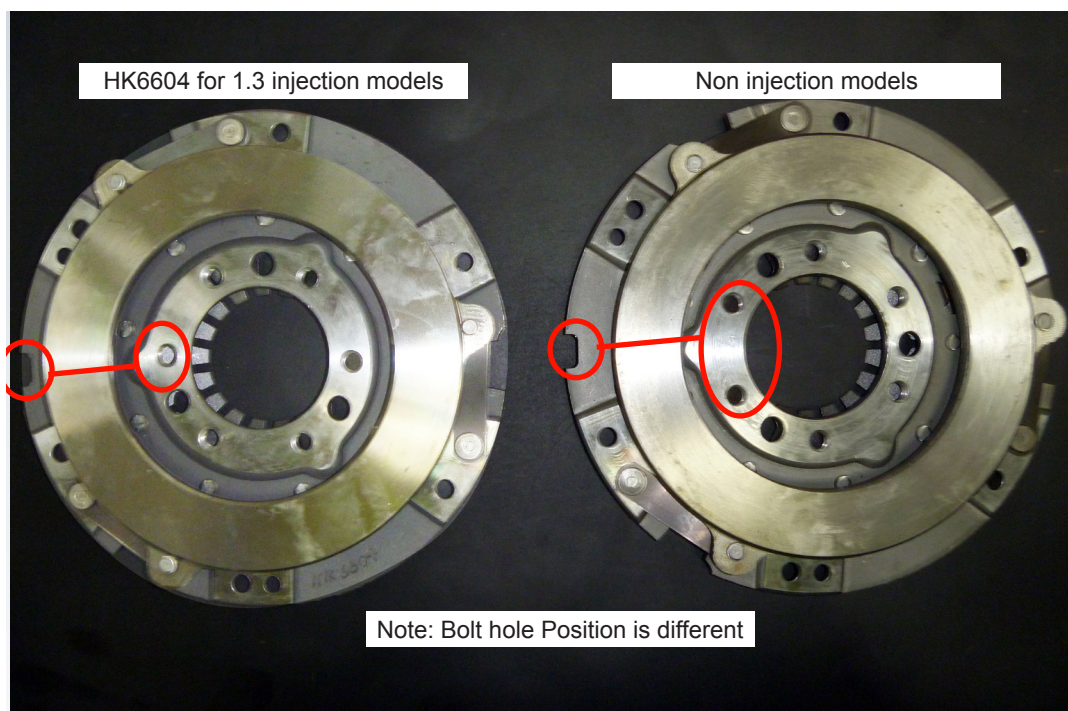

www.borgandbeck.com

TECHNICAL INFORMATION