

Citroen C6: Increased engine idle speed

Question: We are having trouble diagnosing a fault on a 2007 Citroen C6 2.7 HDi with an increased engine idle speed. The vehicle came in with the engine malfunction indicator lamp (MIL) illuminated and several engine management trouble codes stored. We have visually checked the intake system for air leaks but have not found the cause of the fault. Have you come across this increased engine idle speed fault before?

Answer: Yes, we are aware of an increased engine idle speed fault and it affects Citroen C6 models with 2.7 HDi engine. The increased engine idle speed fault, with trouble code P0069, is due to the manifold absolute pressure (MAP) sensor being faulty or contaminated with dirt. Fit a new MAP sensor. Erase trouble codes and check engine idle speed to ensure the fault has been fixed.

