


# Volkswagen Golf - Poor throttle response

**Question:** We are experiencing a problem with a 2010 Volkswagen Golf 1.4 TSI. The engine malfunction indicator lamp (MIL) is illuminated and the car is suffering with poor throttle response. We have checked the components that the stored trouble codes relate to, but we cannot find a solution to the fault. Do you have any ideas?

**Answer:** Yes, from the symptoms you have described, the fault is likely to be due to the crankcase breather hose rubber insert causing the hose to separate at its connection point. This fault affects several Volkswagen models with CAXA engine code. Locate and inspect the crankcase breather hose (Fig.1). If the crankcase breather hose is disconnected, fit a modified crankcase breather hose,

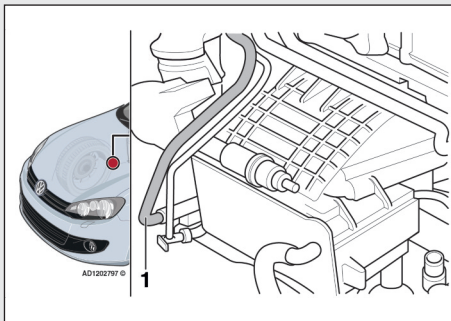

available from Volkswagen parts department. Erase trouble codes and carry out road test to ensure faults have been rectified.