


Mercedes-Benz A-Class: Rattling noise from engine bay when engine idling

Question: We are having difficulty finding the cause of a rattling noise from the rear of the engine bay on a 2013 Mercedes-Benz A-Class 1.5 Diesel when the engine is idling. The rattling noise can be heard when idling or on light throttle but we cannot find the location of the fault. Have you come across this rattling noise before?

Answer: We have come across the rattling noise you have described and it affects several Mercedes-Benz models with 607.951 engine code up to 10/2015. The cause of the rattling noise is the turbocharger (TC) outlet pipe retaining clip becoming insecure. Fit a new turbocharger (TC) outlet pipe retaining clip available from Mercedes-

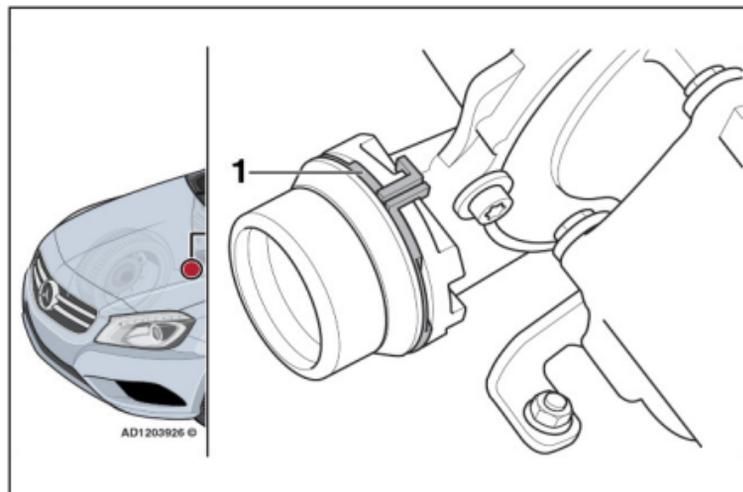

Benz parts department Fig.1.1. Start engine and confirm rattling noise has been rectified.

Autodata