


Citroen C5 III: Engine oil level warning

Question: A 2011 Citroen C5 2.0 HDi we have just serviced, has the engine oil level warning message displayed, even though the engine oil is correct. There are also trouble codes stored in the multifunction control module fault memory: B1818, F159. Have you any ideas where to start to fix this car?

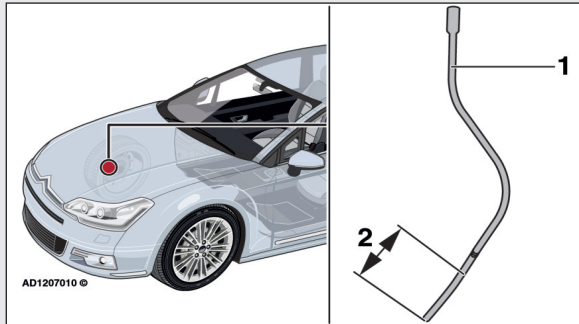

Remove bottom 6cm (at 2 above) from the dipstick (1)

Answer: Yes, we are aware of a problem affecting C5 III models with RHD/RHE/RHH engine codes. The cause is due to an unsatisfactory design of the engine dipstick tube, restricting entry of engine oil leading to an incorrect engine oil level reading. Remove the engine dipstick tube Fig.1.1.

Modify the engine dipstick tube by cutting 6 cm off the end section Fig.1.2. Refit engine dipstick tube. Check engine oil level is correct. Then erase all trouble codes.