


# Blue Print ADG030148, ADG030149, ADB113012

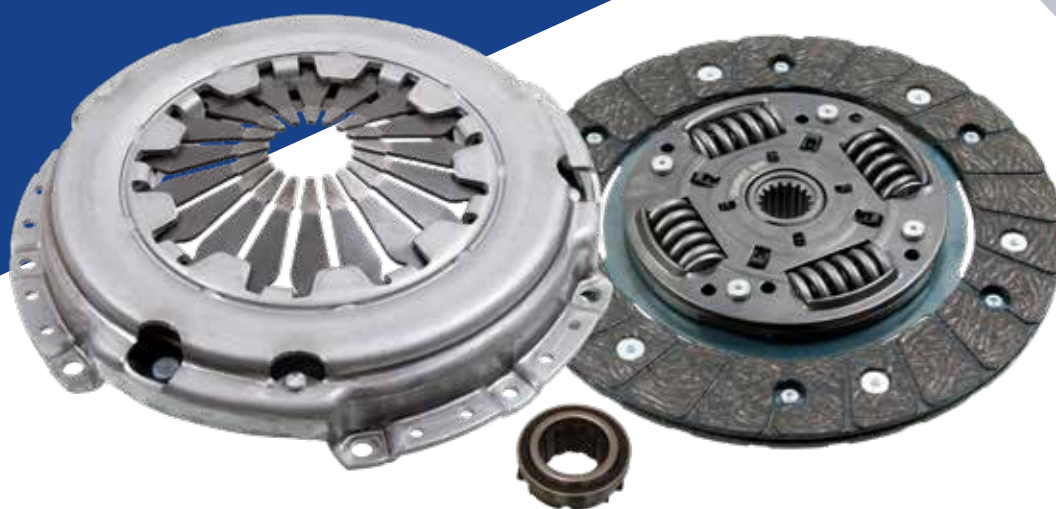

To fit:  
BMW MINI 1.4i, 1.6i and 1.4TD 2001 > 2008

EN



## Clutch kit

### Problem

The vehicle exhibits symptoms such as the clutch not engaging, difficult gear selection and clutch 'judder'.

### Cause

The welded area on the clutch fork can fracture. This allows the clutch fork to flex during operation, preventing the clutch from fully engaging. (Fig.1)

### Solution

It is imperative that the clutch fork and the guide tube are cleaned and thoroughly inspected for fatigue or damage when the transmission is removed as part of a clutch replacement.

It is recommended that the clutch fork is replaced at the same time as the clutch, because the fork failure is a known issue with the MINI models listed above. Failure to identify and replace a faulty fork can cause clearance problems and difficulty in selecting gears. It is also recommended that the fork pivot bushes and locking pin are renewed at the same time.

For more technical information please visit: [partsfinder.bilsteingroup.com](http://partsfinder.bilsteingroup.com)