

# Technical Bulletin

Technical Helpline: +44(0)1622 833004 Fax: +44(0)1622 834004


## Nissan Micra Alternator ADN11105 / ADN11110 / ADN11112 / ADN11113

Date Issued: 01/05/04

We have experienced several instances where the above alternators have been fitted to a Nissan Micra and have appeared not to be charging the battery. Our investigations have shown that, in most cases, the problem is due to a poor connection in the vehicle wiring harness and not a fault with the connector plug on the alternator.

Please ensure that special attention is made to the condition of the harness connector terminals when fitting this unit to the Micra application and that any sign of corrosion, pitting or burning is rectified prior to its fitment. The connectors inside the harness plug should make a firm connection onto the alternator spade terminals. **PLEASE BE AWARE** - the plastic connector plug will disguise terminal 'looseness'.

If the connector terminals are found to have any of the above symptoms (or if there is any doubt as to their condition), a new terminal kit should be fitted.

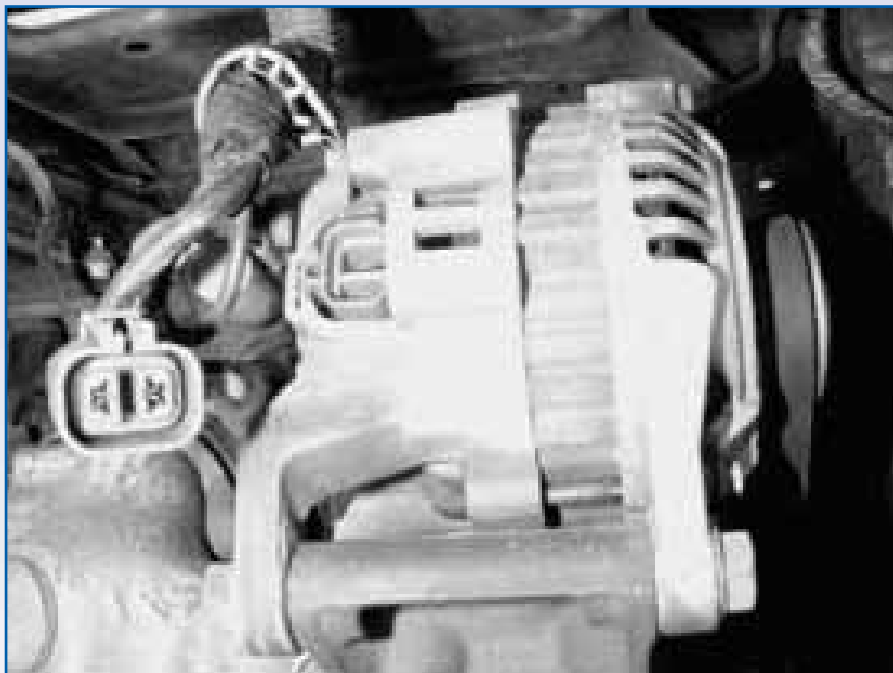

## Examples of ADN11113 on vehicle

**Disclaimer** : Any technical tips are produced in good faith. Blue Print, always recommend that vehicle maintenance and diagnostics are only carried out by suitably experienced people using appropriate tools in a safe manner within a workshop environment. Blue Print, and their customers cannot be held responsible for the correctness of, or misinterpretation of the above technical tips. Images shown are for illustrative purposes only and may not be representative of the products or vehicles described.