



Audi A6 model year 1997 to 2003

Headlamp levelling warning light lights up sporadically

If there are complaints about the above-mentioned fault, a faulty plug-type connection could be the cause. In addition, the fault entry "level sensor interruption / short-circuit to ground" will be stored. This problem can be caused by a loose wire or a plug-type connection not being locked into place correctly.

In this case proceed as follows:

- Lift the rear seat bench (estate) or remove it.
- Pull the plug-type connection apart.
- Check contacts in the connector and the socket, bend them somewhat using a small screwdriver if necessary to guarantee perfect contact.
- Press the plug-type connection together tightly until it locks into place correctly.
- Fold the rear seat bench back down or refit it.
- Delete the fault memory.
- Switch on the ignition and the lights and check to make sure the headlamp levelling function is working properly.

An improved plug-type connection has been used since model year 2003.