



## *Alfa 156, all versions / Sun-Sensor*

The speed of the interior fan suddenly change.

Through an abnormal function of the sun-sensor in contact with the A/C control, the speed of the interior fan can alternate.

This concerns vehicles, up to the identification number : 206065. In the case of a complaint, the cable of the sensor must be disconnected.

Proceed as follows:

- Dismantle the mounting screws of the middle air cap (1).
- Dismantle the info- and air cap unit (3) with a wrench (2) from the retaining channel clamps. Thereafter pull out the unit from the dashboard.
- Dismantle the clamps (4) of the sun-sensor (5) and blame him following through the bore.
- Disconnect the electrical connection (6). The plug must be isolated and fastened so, that no noise occurs.
- Rebuild the sun-sensor.
- Rebuild the info- and air cap unit in reversed order again.

