Bulletin



© Behr Hella Service GmbH, Schwäbisch Hall 12th June 2006 1-1

Alfa Romeo 156 All models with automatic air conditioner

Faulty air distribution

If there are complaints about the above-mentioned fault, an interruption in the calibration run (basic setting of the airmixing flap motor and the air distribution flap motors) could be the cause. This results in the air temperature and the air distribution not corresponding to the value set. This situation occurs when the ignition is switched on directly after the battery has been reconnected. In this case the battery has to be disconnected and reconnected again. Now wait at least two minutes before switching the ignition on.



