



Alfa Romeo Spider Model year from 2001 to 2003

Airbag control lamp illuminates

If there are complaints about the above-mentioned fault, the fault could be the plug-connections of the belt tensioners. The complaint mentioned arises due to increased contact resistances in the multi-plugs of the belt tensioners. When the seat position is changed, a tension load is placed on the plug-connection. Due to poor laying and missing fastening of the cable loom, the plug-connection then becomes disconnected and electrical contact is interrupted.

As the airbag system is concerned, the relevant safety regulations must be observed.

In this case, proceed as follows for both seats:

- Switch off the ignition.
- Check the plug-connection (contacts) for damage, and repair if necessary.
- Fasten the wiring harness and the multi-plug to the seat frame using cable clips in such a way that the plug connection can no longer be pulled apart.
- Finally, delete the fault memory.

Bulletin