



Alfa Romeo Spider With 2.0 I engine

Engine runs rough and/or backfires.


If there are complaints with these vehicles that the engine runs rough and/or backfires, one possible cause is a damaged cable to the ignition coil. In this case the voltage supply cable to the ignition coil is jammed by the plastic cover and damaged. To eliminate the fault the damaged cable has to be repaired. To prevent damage happening again, the cable has to be routed in such a way that it can no longer become jammed. The plastic cover may have to be deburred.



Cover



Voltage supply

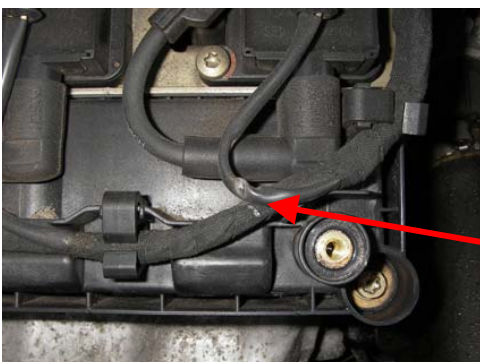

Damaged cable