



Audi 100 (4A,C4) build year 93-06.94 A6 (4A,C4) build year 06.94-02.97

Orifice tube slides too deeply into the evaporator pipe.

At the evaporator, on the above mentioned vehicle, it is possible that the orifice tube slides too deeply into the pipe of the evaporator (picture 2) and is not removable. This is caused by a too small step in the evaporator pipe which contains the orifice tube.

If the evaporator is renewed the orifice tube should also be renewed. The new orifice tube should be fitted carefully to avoid pushing it over the step (picture 2).

If the orifice tube has slid too deep into the pipe, the Hella tool 8PE 351 229-021 can be used to remove it. If the tool is too short, it can be lengthened with a longer screw and suitable flat washer (picture 3 and 4).



Picture 1



Picture 2



Picture 3



Picture 4

Bulletin