



Audi A3 (8P)

Lack of cooling performance and noises from the engine compartment

If there are complaints about the above-mentioned faults, the cause could be a worn refrigerant hose (Fig. 1). Due to an incorrect angle of the refrigerant hose from the compressor to the condenser (high pressure line), the hose can come into contact with the radiator fan.

In this case the hose and fittings have to be replaced. The new hose must then be fixed in place using a closed clip (Fig. 2) or a cable tie, in such a way that contact with the radiator fan is no longer possible. From chassis number 8P4A017591 onwards improved refrigerant hoses with modified angles have been used.

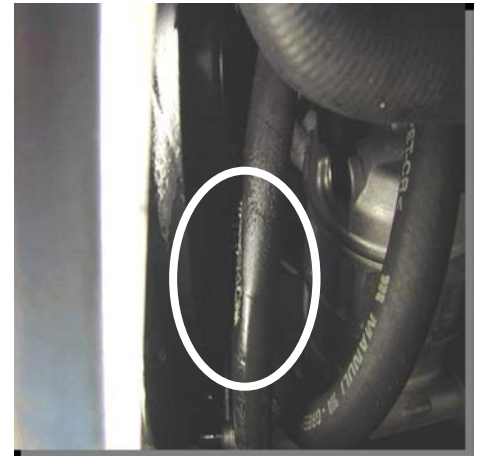


Fig. 1



Fig. 2

Bulletin