



## **Audi A4 1.9 TDI Engine code AWX**

### **ESP light illuminates, fault code 17911 in the control unit.**

With these vehicles it is possible that after a certain distance (approx. 5-10 km) the ESP light illuminates and the fault code 17911 (P1503 = alternator load signal) is stored in the control unit. When the ignition has been switched off, the ESP light initially stays off and illuminates again after another 5-10 km. The reason for this fault could be a corroded or loose cable connection between the engine control unit and the alternator connection DF (signal cable for alternator charge state). For the fault to be eliminated, the connection must be repaired and the fault code deleted.