Bulletin



© Behr Hella Service GmbH, Schwäbisch Hall 01. Oktober 2005 1-1

BMW

All vehicles with automatic climate control

Disconnecting the battery

When the battery is disconnected, shortly after switching off the ignition, a fault code could be stored after reconnecting the battery.

This is caused by the defroster doors for example. The defroster doors move to their park position 2 minutes after switching of the ignition. If the battery is disconnected before the defroster doors arrive at the park position the contol unit stores a fault code.

It is necessary to wait 15 minutes after the ignition is switched off before the battery should be disconnected. To read out the fault memory and to erase the fault code a suitable diagnosis tool is needed.



Bulletin

