



BMW 3 Series (E46) All vehicles with slide/tilt sunroof From model year 12.1998 to 08.2000

Slide/tilt sunroof cannot be opened or closed anymore.

If there are complaints about the above-mentioned fault, the cause may be an over-sensitive setting of the control module for the slide/tilt sunroof.

The slide/tilt sunroof is equipped with an anti-pinch function which, under certain circumstances, may respond too early. Through the activation of the anti-pinch function, initialization (position detection) of the slide/tilt sunroof is no longer available.

In this case, a re-initialization must be carried out. To do this, proceed as follows:

- Keep the slide/tilt sunroof switch pressed in the tilt direction until the final position is reached.
- Keep the switched pressed for a further two seconds.

If the complaint cannot be resolved by this measure, the drive unit and the control module of the slide/tilt sunroof must be replaced.