



BMW 7 Series (E38) Model year 11.1994 to 11.1995 All vehicles with automatic air conditioning

Failure of the control panel

If there are complaints about the above-mentioned fault, the cause could be a resistor in the control panel. Due to incorrect placement, the circuit board was fitted with an additional resistor. The control panel may not fail completely. Sometimes, only the display functions (meaningless displays or no display) in the display are affected. In order for the control panel to work properly again, the resistor (R58) must be removed from the circuit board (see illustration). Due to the fact that special tools are needed for this work, the control panel should be removed and brought for repair to the manufacturer.

