# Bulletin



### BMW 7 Series E 65/66 All models Model year 2001–2008

## Front and rear axle brake system squeals when applying light braking force

If the above fault occurs, it may be associated with the brake lining wear indicator. When applying light braking force, the thermal contact on the brake disk may drag, thereby causing an unpleasant squeal. In this case, the thermal contacts must be checked and, if required, replaced with the new versions. OE part number: front thermal contact 34356778037 rear thermal contact 34356778038

#### Hella Pagid spare part numbers

Brake lining thermal contact, front axle: 8DK 355 250-201 Brake lining thermal contact, rear axle: 8DK 355 250-531

#### **Repair note**

In this case, it is advisable to check the brake disks and brake linings for wear and, if necessary, replace them.

© Hella Pagid GmbH



Reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, are all prohibited without our express written approval and when there is no indication of the source. The schematic illustrations, pictures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved. All rights reserved.

