



BMW E36 with climate control

Flickering display of the climate control panel.

If on this vehicle model the customer complains a flickering display of the climate control panel, a possible cause could be the instrument panel illumination control. If the instrument panel illumination is switched to the highest level, the display could start to flicker. If the flickering stops, when the instrument panel illumination is switched to a lower level, the instrument panel illumination control must be renewed.



Climate control panel



Instrument panel illumination control

Bulletin