



BMW E46

Build year 02/1998 – 08/1998

No air flow due to icing evaporator

On the above mentioned vehicles with climate control, an icing of the evaporator can occur after longer running A/C and high outside temperature. You can notice that by the fact that less and less air comes from the air outlet. The interior fan continues to work normally. A few minutes after switching off the A/C, a larger quantity of condense water can be found under the car. After this the A/C works normally again. In this case it is possible that the control unit (up to production date 30/98) is the cause. From production date 31/98 (31st. week 1998) these are changed at the factory. You can find the production date on the factory label on the control unit.

Bulletin