



## ***Chrysler PT Cruiser all models up to model year 10 | 2000***

### **Ticking noises from the rear passenger compartment**

If there are complaints with this vehicle about ticking noises that can be heard coming from the rear passenger compartment, the bodywork ventilation grille is one possible cause for this. This noise can be heard most clearly when the interior fan is running at its maximum setting. In this case, the ventilation grille vibrates against its housing. To eliminate the fault the ventilation grille must be replaced. To do this proceed as follows:

- Remove the side panelling at the bottom left of the boot
- Remove the ventilation grille by loosening the two retaining straps (top and bottom) from the side panelling
- Insert new ventilation grille
- Refit the side panelling
- Check after replacement as to whether the ticking noise has been eliminated

**Bulletin**