



Chrysler Voyager from 1996

Engine: 3,3 + 3,8 Litre

Damaged compressor-line

For the above-mentioned vehicles it is possible that the high- or low pressure-line is cracked in the vicinity of the compressor. The cracking can be caused by an improperly secured compressor. Excessive vibration will eventually also crack the compressor mounting brackets. Therefore check the torque of the mounting bolts. The correct torque is 54 Nm.

Bulletin