

© Hella KGaA Hueck & Co., Lippstadt

12<sup>th</sup> June 2006

1 1

## Citroen Berlingo Up to model year 30.06.1997

## **Humidity in the rearlights**

If there are complaints about the above-mentioned fault, insufficient water drainage or insufficient ventilation could be the cause. In this case, humidity collects in the light and can cause corrosion on the plug contacts and bulb sockets. In this case, proceed as follows:

- Check the light affected for damage and replace if necessary.
- Unscrew the rearlight.
- Check the microcellular rubber for damage and replace if necessary, since a faulty seal will lead to excessive water penetration.
- To ensure that the fault is eliminated permanently, two small holes have to be made in the bottom part of the light (see illustration. These can easily be made using a small file.
- Clean the corroded parts.
- Then fix the light in place again and check for leak-proofness and function.





