



## **CITROËN**

### **C4**

### **With 2-zone air-conditioning**

### **Outflow temperature air conditioning**

### **Interior - temperature regulation**

#### **Problem:**

Temperature regulation may not work correctly due to defective motors. Typical symptoms are deviations from the pre-set temperature and the actual outflow temperature of the interior air. This can occur on either other both sides (zones) of the instrument panel.

#### **Possible cause:**

Excess wear of the cog wheels of the air mixture valves on the control motors.

#### **Solution of the problem:**

A repair set (6450XZ) should be requested from the auto manufacturer. This consists of 2 adapter plates, drive sprockets, and screws (see the illustration), with whose help the functioning of the control motor will be restored.

