



Citroen C5 ***Model year from 2000 to 2004*** ***All models***

Headlights stay on

If there are complaints about the above-mentioned fault, the cause could be a faulty body control unit (built-in systems interface – BSI). Water penetration into the control unit causes a short-circuit there. This leads to the fact that the headlights cannot be switched off, even after stopping the engine and switching off the ignition. In this case, the control unit must be replaced. This is located on the driver side, below the 16-pole diagnostic plug. After installation, the control unit must be re-coded.

Bulletin

