## **Bulletin**



© Hella KGaA Hueck & Co.,	6. Mai 2010	1-1
Lippstadt/Germany		

## Citroen C6 Model year: from 2006 Engine code: DT17TED4 (Type UHZ) Engine misfiring, poor performance

## **Diagnostic control lamp lit**"Anomaly exhaust detoxication" is displayed on the multi-function display

The above-mentioned fault indicates a defect in the exhaust gas purification system. In this case, you would think of a clogged particulate filter (FAP).

If the check or replacement by a new component does solve the problem, the cause could be in the fuel filter.

Lumps may form in the filter element from about 30,000 km onwards.

The symptom is favoured if bio-diesel is used.

Likewise, the additive for periodic regeneration of the FAP may contribute to lump formation and clogging of the fuel filter.

**Solution:** Replace fuel filter element.

**Practical tip:** Replace the fuel filter every 30,000 km within the defined inspection intervals as a precaution or at least check it for soiling.



.