



Citroen

Xsara Picasso

Model year: 1999–11.2002

All models

Interior blower not working

If the interior blower stops working in the case of the above-mentioned vehicles, the ignition switch in particular should be checked when troubleshooting. As the entire current for the supply of the interior blower flows via the ignition switch, the 40-ampere fuse and then via the blower switch, the contacts of the ignition switch can “burn”. This then leads to the failure mentioned. In the event of damage, the ignition switch must be replaced and the power supply of the interior blower wired via a power relay. The old power supply coming from the ignition lock is then used only as the plus-side control cable. In relation to this, the aid of a vehicle-specific circuit diagram is recommended.

Bulletin