



Citroën XM (Y4)

ABS warning light comes on/ ABS not working

If the above problems occur with these vehicles, it is often caused by corrosion in the connection plugs of the ABS sensors. The plug-connections corrode due to penetrating moisture. The moisture usually penetrates deep into the cable wires and leads to contact resistance such that repair of the plug-connection is not advisable.

Check all plug-connections and ABS sensors for resistance if functional problems occur. The sensors involved are inductive sensors with a resistance value of 1100 (+/- 110) ohms.

New ABS sensors can be found in the Hella Electronics Catalogue.

Hella ABS sensor front:

Part no.: 6PU 009 106-121



Hella ABS sensor rear:

Part no.: 6PU 009 106-131

