



## ***Fiat Multipla Bipower***

### **Intermittent illumination of the ABS/EBD lamp following use of the windscreen wiper**

If there are complaints with these vehicles, that after the windscreen wipers have been switched on (intermittent function) the ABS/EBD warning lamp illuminates intermittently and the "Proceed to nearest workshop" warning lamp is on, a possible cause is the intermittent wiper relay. This relay causes electrical problems that are recorded by the ABS system. To eliminate the fault, a diagnostic tool should be used to read out the fault memory of the ABS control unit. If there is no fault code stored, the intermittent wiper relay must be replaced.

The part number of the new relay is identical to the one of the old relay. The new relay can be identified by the white markings.

To prevent these problems recurring, the new relay has been fitted with several diodes and a resistor.