



## ***Fiat Multipla***

### **Leaking dryer connection**

With some of the above-mentioned vehicles there can be leaks at the fitting (Fig. 1) between the refrigerant pipe from the condenser to the dryer. The cause for this can be the guide of the fitting flange being 0.6 mm too long (Fig. 2). This prevents sufficient pressure being applied to the O-ring. The problem can be eliminated by shortening the guide.

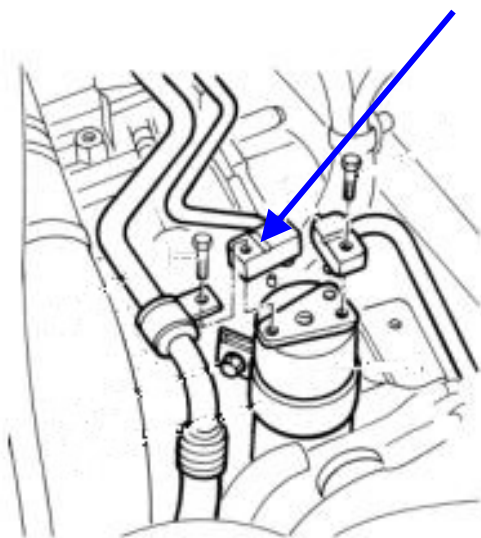


Fig. 1



Fig. 2

**Bulletin**