Bulletin



© Behr Hella Service GmbH, Schwäbisch Hall

01. Oktober 2005

1_1

Fiesta `96 Build Year 08.95-08.99 Puma Build Year 08.95-08.99 Ka Build Year 09.96-08.99

Some vehicle in this build range experience drumming noises from the dashboard when the temperature position is between minimum and maximum.

To rectify the problem:

To rectify the problem the insulation of the heater valve and the left hose from the valve to the heater must be changed.

- 1. Remove the heater valve and the left hose
- 2. Remove the insulation and fit the new one
- 3. Fit the new hose and the heater valve

Please note:

It is important that correct de-aeration of the cooling system is carried out.

- 1. Put control switch of the heating on maximum
- 2. Fill up coolant to maximum and replace the reservoir cap
- 3. Start the engine, bring it to operating temperature at 3000 rpm (Fan must run twice)
- 4. At idle check the coolant, then stop the engine
- 5. Check the coolant again after 1 hour again and top up if necessary

Regards

Your Service Partner Technical Team

Bulletin

