



## *Fiesta '96 with 1,8 Endura-DE-engine, build year 08.95 – 10.96*

Squealing generator belt / discharged battery


### **To rectify the problem:**

The cause of the problem is a broken generator bracket, which must be changed. Additionally a new screw with a flat washer, for the generator, must be fitted.

1. Remove the generator
2. Remove the generator bracket (4 screws)
3. Fit the new mounting, dispose of the old one
4. Fit the generator with the new screw

### **Please note:**

The lower rear mounting screw must be fitted to the lower front and the new screw, with the flat washer, must be fitted to the lower rear mounting.

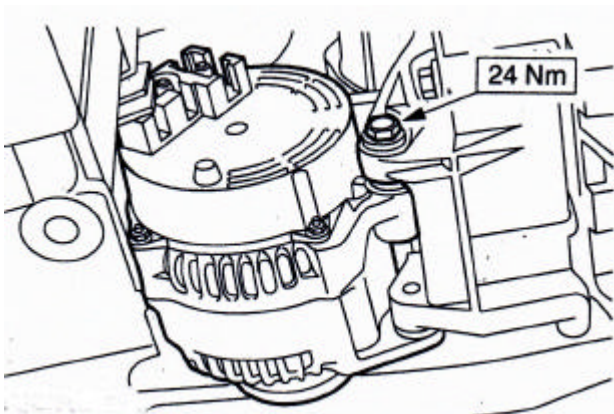

Best Regards  
Your Service Partner Technical Team

Bulletin

