




Ford Cougar

Windscreen air vent becomes loose, air flow is diverted.

If there are complaints with these vehicles that the lateral ends of the windscreen air vent become loose, one possible cause is a distorted air vent. To eliminate the problem, the air vent must be removed and fitted with new self-adhesive Velcro pads. To do this proceed as follows:

- Unclip the windscreen air vent and remove it.
- Separate the connector from the sun sensor.
- Attach new self-adhesive Velcro pads (approx. 2.5 x 2.5 cm) to the rear side of the air vent and the dashboard (see illustration)
- Cut out the Velcro pad in the area of the sun sensor.
- Connect the sun sensor connector, clip the air vent in place again and press the Velcro pads against one another.

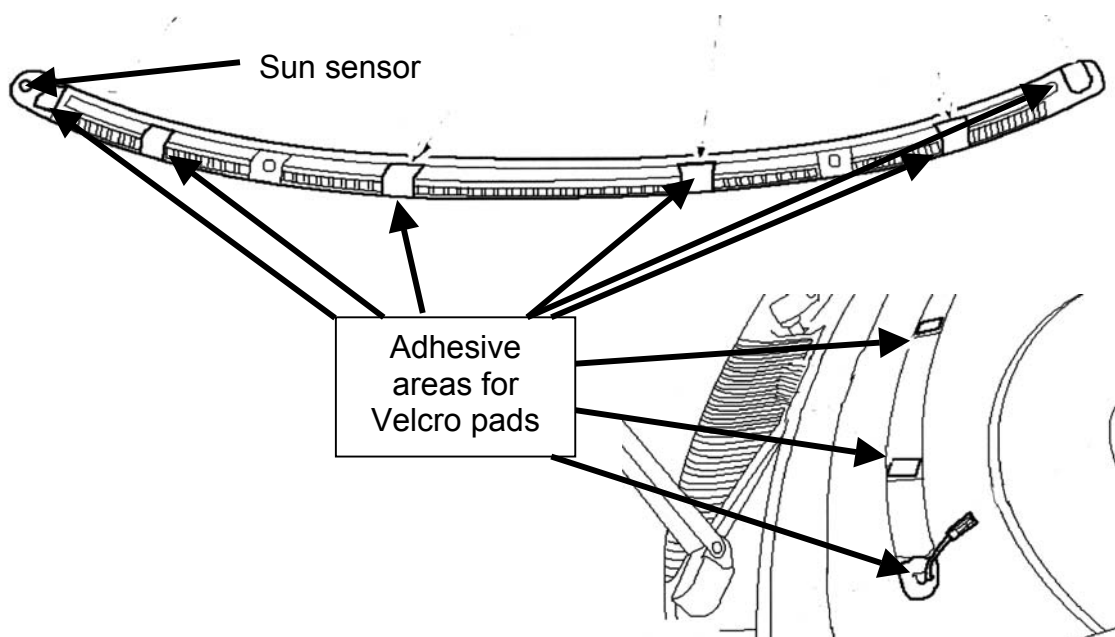

Bulletin