



Ford Escort, Build Year 10.95-12.97

Some vehicle in the build range can experience water ingress in the front foot well. This is due to the condensation water routing of the evaporator body being wrong.

To rectify the problem:

To rectify the problem Ford recommend to change the evaporator body.

1. Drain the air conditioning system
2. Remove the evaporator
3. Remove the evaporator core and fit the new one
4. Fit the evaporator and the other parts in reverse order
5. Renew the receiver dryer
6. Evacuate and refill the air conditioning system
7. Check for operation

Since the 12.97 the replacement evaporator core is fitted by Ford.

Regards

Your Service Partner Technical Team

Bulletin