



Ford Fiesta Model year 1989 – 1995 with 1.1 and 1.3 litre HCS engine

Engine judder, poor throttle response, rough idling

If there are complaints in relation to these vehicles concerning engine judder, poor throttle response and rough idling, one possible cause is a damaged cable on the throttle valve potentiometer. Due to ageing, the cable insulation becomes brittle and breaks away. This leads to the cables coming into contact with one another, which in turn leads to incorrect values in the engine control unit.

To eliminate the fault it is usually sufficient to re-insulate the cables and to erase the fault memory by disconnecting the battery.

Important:

The radio code should be available before the battery is disconnected.

Bulletin