



Ford Fiesta From model year 2003 All vehicle with 1.4 TDCI engine With engine code F6JB

Inadequate engine performance

If there are complaints from customers about the above-mentioned fault, the cause could be a defective EGR valve. In addition, there may be complaints about increase black-smoke build-up and the illumination of the engine control lamp. When taking a readout of the fault memory, the fault codes P1412 (EGR valve stuck) and P0404 (exhaust gas recirculation section/function fault, hose leaky or blocked, wiring harness EGR valve) may be stored. In this case, a modified EGR valve should be fitted and a newer software status (version B44 or higher) should be installed. After the repair, delete the fault memory.

Bulletin

