



## **Ford** **Fiesta V until model year 07/2003** **Fusion until model year 07/2003**

### **Air distribution cannot be adjusted correctly.**

If there are complaints with these vehicles that the air distribution of the ventilation system cannot be adjusted perfectly, one possible cause is the control shaft of the air-distribution flap. The complaint is that with "windscreen" selected, too much air is directed into the footwell. In order to eliminate the fault, the control shaft of the air-distribution flap must be replaced.

To do this, remove the glove box. Unlock the snap-fit tab on the control switch and pull out the control shaft. Dismantle the control shaft on the heat exchanger/evaporator housing. Fit the new control shaft and refit the glove box.

After this, check the air-distribution flap for perfect function.

**Bulletin**