



Ford Focus up to Model Year 10/1999 Mondeo up to Model Year 11/1998 Cougar up to Model Year 07/1998 All Vehicles with auxiliary warning system

Interior or door entry/exit lights illuminate continuously, anti-theft alarm malfunction

In the event of complaints on these vehicles that the interior or door entry/exit lights continue to illuminate after closing the door and the anti-theft alarm malfunctions or is not activated, the door pillar switch is a possible cause. The door pillar switch is located in the door jam on the B-pillar or C-pillar. To eliminate this malfunction it is necessary to replace the door pillar switch completely together with the closing wedge. For this proceed as follows:

- Mark installation position of closing wedge. Remove closing wedge (Caution: Secure retaining plate with screw to prevent it from slipping away).
- Install new closing wedge. Align closing wedge and tighten screws lightly. Close door and check installation position
- Tighten screws on closing wedge to 31 Nm.