



Ford

Galaxy

Model year: 11.1998–11.1999

Engine: 2.0 + 2.3 l DOHC

Compressor failure

If the air conditioning system does not provide any cooling power after switching on, this may be related to a failure of the compressor. When replacing the compressor, in addition to the usual process (flushing, dryer replacement etc.), a modified suction and pressure line (compressor line with oil reservoir) must be fitted, and the drive belt must be replaced. In addition, in the case of all vehicles, the drive-train control unit (PCM) must be recalibrated. The calibration must be documented with a yellow sticker on the control unit. Please contact an authorized dealer in relation to this.

Bulletin