



Ford Galaxy, build year till 04/1998 with self regulating air conditioning

Outside temperaturer is shown faulty
in the air conditioning display.

Due to the location of the outside temperature sensor a faulty indication in the air conditioning display is possible. To rectify the problem the location of the sensor must be changed. For this consider the following steps:

1. Remove front flashers
2. Remove radiator grille (four screws / two clips)
3. Remove outside temperature sensor from radiator support panel
4. Cut the wire 10 cm before the plug
5. Lengthen the wire to the new location on the lower, left cover of the bumper
6. Protect the wire with a protection sleeve and solder the plug on
7. Remove the lower left cover from the bumper, if there is no bracket for the sensor on the cover it must be renewed, fit sensor
8. Fix the wire onto the crossmember
9. Refit the cover, radiator grille and flashers

Bulletin