Bulletin



© Behr Hella Service GmbH, Schwäbisch Hall 8 January 2007 1-1

Ford Galaxy Model year: 1995–2002 With air conditioning system

Refrigerant loss / Line chafes on engine cover

In the case of vehicles of the above-mentioned model years, it may be hat the suction line of the compressor and/or the line to the dryer chafes on the engine cover. In the worst-case scenario, this can lead to a leak. If this chafing is found during maintenance or repair work, a cutout should be made in the lower engine cover in such a way that contact with the refrigerant lines can no longer occur. Edge protection should be applied to the cut edges. The lines should be additionally protected by fitting chafing protection. The lines must be checked for damage and, if necessary, must be replaced.



