



Ford Galaxy 2.3I with Xenon light Model year from 2000

Light source replacement

To replace the light source in the above-mentioned vehicle, proceed as follows:

- Switch off the ignition.
- Remove the cover on the left-hand headlight (lamp mark) by pulling it upwards (see Fig. 1).
- Loosen the headlight attachment screws (see Fig. 2 and 3). The screw in Fig. 3 can only be reached using a long screwdriver or respective ratchet extension.
- Remove the attachment screws (see Fig. 4).
- Remove the plastic grille (see Fig. 5).
- Separate the central plug from the headlight (see Fig. 6).
- Remove the ballast screws (see Fig. 7).
- Remove the headlight cover screws (see Fig. 8).
- Turn the ignition module anti-clockwise and remove from the Xenon light (see Fig. 9).
- Remove the Xenon light screws and replace the bulb (see Fig. 10).
- Parking light, indicator and driving light can be replaced easily.
- Replace the removed parts in reverse order.
- Check the system for perfect function.
- Adjust the headlights with the aid of a diagnosis tester (read out fault code, basic setting of headlight levelling etc.).

Bulletin





Fig. 1



Fig. 2



Fig. 3



Fig. 4



Fig. 5



Fig. 6

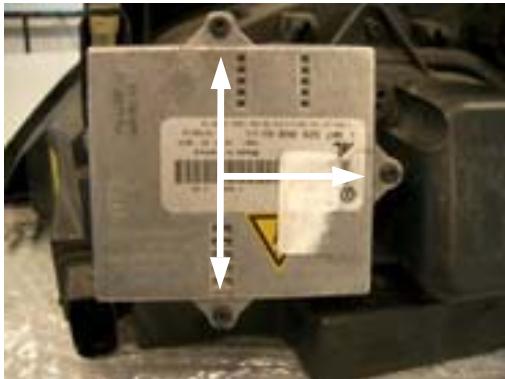


Fig. 7

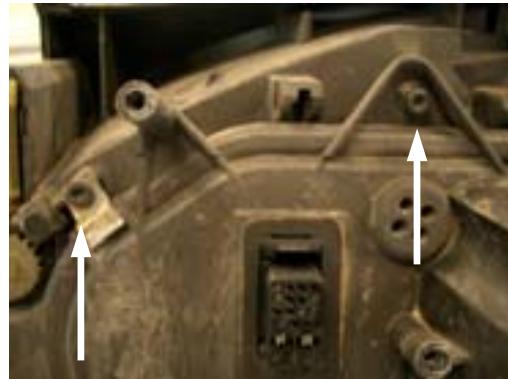


Fig. 8



Fig. 9

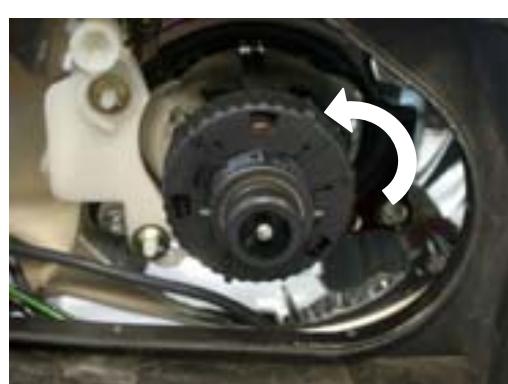


Fig. 10