
© Behr Hella Service GmbH, Schwäbisch Hall

4<sup>th</sup> May 2006

## Ford Galaxy Seat Alhambra VW Sharan Model year: up to 01/1998 Engine: 1.9 TDI

## Loss of coolant

If there should be complaints about a loss of coolant with the above-mentioned vehicles, this can be caused by the overflow hose being damaged or having slipped. In the case of vehicles built before 25.01.1998, check the overflow hose from the coolant expansion tank for a tight fit and damage. Damaged hoses must be replaced. The overflow hose should be secured to the charger intercooler by a cable clip (photo). In addition, care must be taken that the hose is sufficiently secured on the expansion tank against slipping.

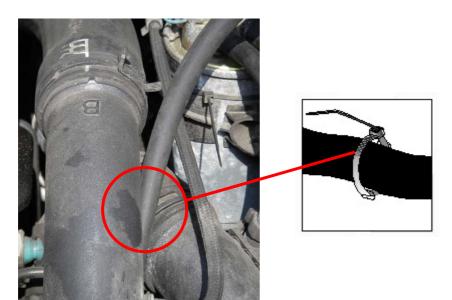





1-1