



Ford Transit with 2.5 litre diesel engine (63KW / 85PS) Model year 08.1995 – 07.1997

Engine warning light illuminates briefly, and/or heavy black smoke after starting.

If there are complaints in relation to this vehicle concerning the fact that the engine warning light illuminates for about 3 seconds after the ignition has been switched on, and/or that heavy black smoke is produced when starting, one possible cause is a faulty potentiometer on the exhaust gas recirculation valve. In this case, the potentiometer resistor is excessively worn.

To eliminate the fault, the entire exhaust gas recirculation valve must be replaced.

Bulletin

