## **Bulletin**



© Hella KGaA Hueck & Co., Lippstadt

20. Februar 2004

\_\_\_\_

## Ford Transit Model 2001 Built from 05/2000 - 04/2002

## Failure of the brake lights, exterior lighting and horn.

If there are complaints with these vehicles that the brake lights, exterior lighting and horn fail and that fuses 3, 7, 9, 23, 24 in the engine compartment and 49 and 51 in the passenger compartment have blown, one possible cause is a damaged wiring harness. This damage will be located behind the left-hand headlamp.

To eliminate the fault proceed as follows:

- Remove the left-hand headlamp.
- Check the wiring harness for damage behind the headlamp, in the area of the chassis leg.
- If damage is found, repair the cables. Before beginning the repairs, disconnect the battery (note the radio code).
- Repair the faulty cables using solder connectors, ensuring that the cables are watertight.
- Following the repair, use an additional protective sleeve to protect the wiring harness against repeat damage.
- Replace all blown fuses.
- Reinstall the headlamp. Reconnect the battery.
- Check the function of the brake light, the exterior lighting and the horn.
- Enter the radio code and reprogram the stations.



