Bulletin



© Hella KGaA Hueck & Co., Lippstadt

1 August 2007

4.4

Honda Accord Coupe Model year from 1999 until 2000 All models

Immobilizer control lamp flashes.

If there are complaints about the above-mentioned fault, the cause could be a defective receiving coil on the ignition lock. In addition, there may also be complaints that although the starter turns when trying to start, the engine does not start. In this case, the cable connection between:

- immobilizer control unit terminal 3 and engine control unit terminal A13 and
 - immobilizer control unit terminal 2 and engine control unit terminal A 25

should be checked for short-circuit, short to earth, as well as for a break. If no faults can be found there, the receiving coil must be checked and, if necessary, replaced.



