



Hyundai Santa Fe + Sonata

Evaporator can ice up

In the case of the above-mentioned vehicles there is the danger of the air conditioning system switching off of its own accord. This may be due to an iced-up evaporator. The evaporator temperature sensor fitted at the factory tends to switch off the compressor too late, which can lead to the evaporator icing up. Should the above-mentioned problems occur, the temperature sensor must be replaced with a modified version:

Manual air conditioning system:

Old part number: 97614-38000

New part number: 97614-3D000

Climate control system:

Old part number: 97614-38200

New part number: 97614-3D200

In addition, the installation location of the temperature sensor has been changed. Instead of being in the centre of the evaporator, the new sensor is fitted at the top right-hand side of the evaporator on the air outlet side.

Bulletin