



Lancia Lybra, all models with ESP

Illumination of the ESP warning light

If the above mentioned failure is queried, the cause could be the steering angle sensor. After every disconnection and re-connection of the supply voltage for the steering angle sensor, e.g. changing the battery, or replacement of the fuse no. 12 in the fusebox, the ESP warning light comes on in the display.

Proceed in this case as follows:

- Vehicle stationary and the key must be in position „Stop”
- Steering wheel in the central position
- Wait 5 seconds and then start the engine
- Turn the steering wheel a half turn to the left
- Turn steering wheel back to the central position and turn it a half turn to the right
- Turn steering wheel back to central position
- Move the vehicle a short distance straight ahead (approx 10 meter)

The steering angle sensor is now adjusted correctly, and the warning light goes out. The fault code memory must now be erased.