Page 1 of 1

© Hella Pagid GmbH., Essen

Reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, are all only permitted with our expressly written approval and when the source is indicated. The schematic illustrations, pictures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved. All rights reserved.

Whenever the above-mentioned problem is detected, its cause can often be found in connection with the cable control guides of the handbrake cable. These vibrations or noises mainly occur when driving takes place on uneven

It can happen that the cable has too much play within its supporting bracket and, consequently, it begins to rattle when there is increased suspension movement. In such cases the cable is to be loosened from its mounting bracket, the excessive play corrected by means of a felt strip and then the cable once again secured in position.

All models up to VIN 3027759

Model year: 2003 - 2011

It is also recommended to secure the supporting bracket with a cable tie.

Any damaged parts resulting from the problem are also to be replaced during such repair work.

Bulletin

Ypsilon (843)

Vibrations and noises

on the rear axle

roads and surfaces.

Lancia





